

Date: Thursday, 3/13/2008 10:21:29 AM
 User: Kim Johnston

Process Sheet

13

Customer : CU-DAR001 Dart Helicopters Services Drawing Name : AFT X-TUBE EXT HEIGHT GEAR
 Job Number : 37940
 Estimate Number : 10421
 P.O. Number :
 This Issue : 3/13/2008 S.O. No. :
 Prsht Rev. : NC Drawing Number : D205596103
 First Issue : / / Type : LANDING GEAR Project Number : N/A
 Previous Run : 37939 Drawing Revision : B
 Material :
 Due Date : 3/27/2008 Qty: 1 Um: Each
 Written By :
 Checked & Approved By : 080313
 Comment : Est Rev:G 05.06.10 Acid etch moved to Step 11 KJ/JLM
 Est RevH 08-01-10 ECN 1075 DD

Additional Product

Job Number:



Seq. #: Machine Or Operation: Description :

1.0 DC DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Photocopy D205-594 bluefile & type labels per PPP D205-596-103CHG001 N/A SEE Wlo 38352

2.0 D2890 Aft Crosstube



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part number Description Batch

1 D2890 Aft Crosstube

B38040 DP. 8-3-28

3.0 LANDING GEAR 1 LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

DP 8-3-28

1-Mark 37.30" for cutting from tangential line in the straight section from D2890 as per Dwg wall template.

4.0 QC15 DIMENSIONAL CHECK OF X-TUBES



Comment: DIMENSIONAL CHECK OF X-TUBES

S 08/09/28

5.0 LANDING GEAR 1 LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Cut as per Dwg D205-596-103

2T 08-03-31

2-Deburr & Inspect for surface damage. Polish cut surface. Scribe part # and batch # on one end of tube.

2T 080401
2T 080401

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 3/13/2008 10:21:29 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: AFT X-TUBE EXT HEIGHT GEAR

Job Number: 37940

Part Number: D205596103

Job Number:



Seq. #:

Machine Or Operation:

Description :

6.0

QC15

DIMENSIONAL CHECK OF X-TUBES



Comment: DIMENSIONAL CHECK OF X-TUBES

5 00/24/02 (71)

7.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

TOUCH UP Chemical Conversion Coat as per QSI 005 4.1

RT 08-04-02

8.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

6 08/24/02 (4)

9.0

SPRAY PAINTING

SPRAY PAINTING



Comment: SPRAY PAINTING

1-Prime inside and outside with Immron per QSI 005 4.2

MA 08 04 02

(1)

10.0

QC14

INSPECT SPRAY PAINT



Comment: Inspect Spray Paint

0804-03 (1)

11.0

D3595063530

RUBBER CUSHION



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)
RUBBER CUSHION
batch _____

see wto 38352

12.0

MS2192028

Clamp(per MIL-DTL-8783C)



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)
clamp(per MIL-DTL-8783C)
batch _____

MA

13.0

D29401

Support



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)
Pick:
Qty Part number Description Batch
2 D2940-1 Support _____

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 3/13/2008 10:21:29 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: AFT X-TUBE EXT HEIGHT GEAR

Job Number: 37940

Part Number: D205596103

Job Number:



Seq. #:

Machine Or Operation:

Description :

14.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1- Apply magnobond 6398 as per dwg D205-596-103

Magnobond 6398 Batch: _____

2- Install supports and clamps per Dwg D205-596-103. Torque clamps to 80-100 in lb. as per dwg

15.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

16.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D205-596-103

Location: _____

17.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

08/04/14

Job Completion



mf 08-04-11

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____


QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART AEROSPACE LTD		Work Order:	37940
Description: Crosstube High-High Aft		Part Number:	D205-596-103
Inspection Dwg: D205-596-103	Rev: A B		Page 1 of 1

Required Dimension	Min	Max
Height	37.2	37.4
1/2 Span	58.7	58.9
Angle	49	52
Total Span	117.4	117.8

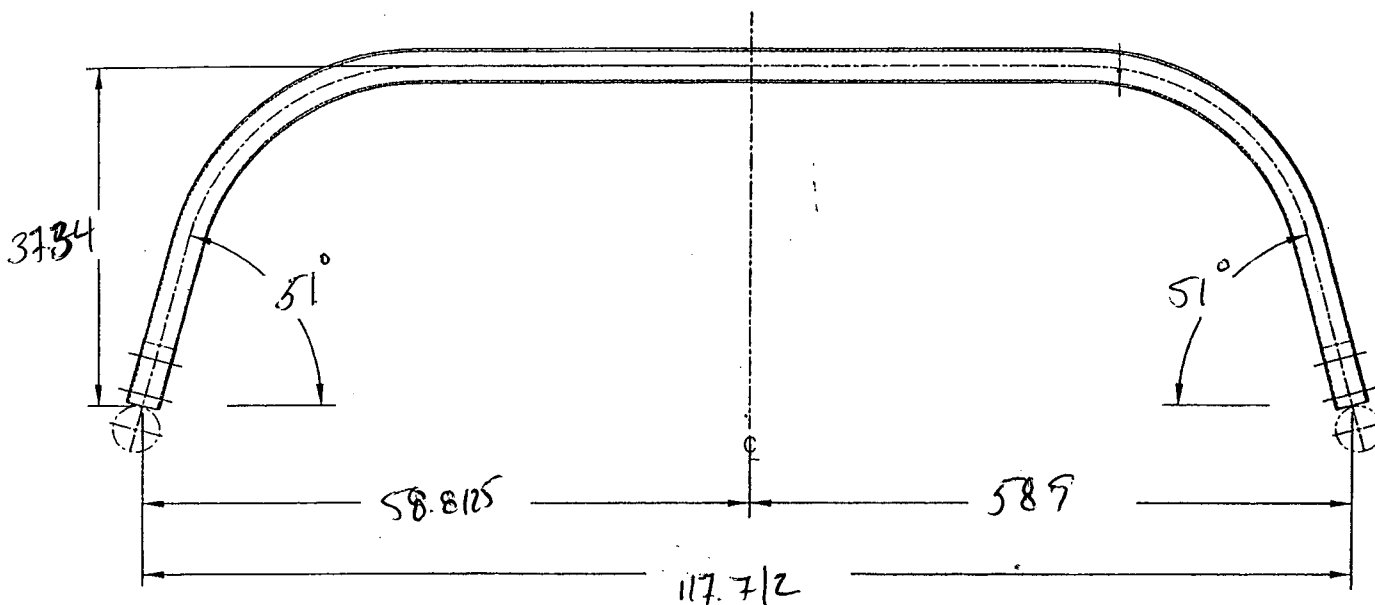

Comments

QC15 Inspection	
Date	08/09/28

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM	

PARTS LIST:

Qty	Part Number	Description
X	D205-596-103	CROSSTUBE ASSEMBLY, HI-HI AFT
1	D6008-180	CROSSTUBE
2	D2940-1	SUPPORT
4	D3595-063-530	RUBBER CUSHION
4	MS21920-28	CLAMP
A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)


GENERAL NOTES:

- 1) MATERIAL: MANUFACTURE FROM D6008-180
FINISHED LENGTH = 146.98 ± 0.02
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART 005 4.2
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: N/A
- 6) IDENTIFICATION: SCRIBE DART PART NUMBER AND BATCH NUMBER IN THIS AREA WITH
VIBRATING STYLUS
- 7) WEIGHT: 55 lbs
- 8) PART IS SYMMETRIC ABOUT CENTERLINE
- 9) BEND PROGRESSIVELY WITH A MINIMUM OF 3 PASSES. MAXIMUM TUBE FLATTENING DUE TO
BENDING IS 6% BASED ON O.D.
- 10) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE
OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS
SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT
LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 11) APPLY A 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF D2940-1 THAT
WILL BE IN CONTACT WITH THE CROSSTUBE. LET CURE FOR 12 HOURS AFTER INSTALLATION
AND PRIOR TO PACKAGING.
- 12) INSTALL MS21920-28 CLAMPS WITH D3595-063-530 RUBBER CUSHIONS TO SECURE D2940-1
SUPPORT ON THE TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE
CROSSTUBE SUPPORT.
NOTE: IT IS ACCEPTABLE TO SUBSTITUTE MS21920-28 CLAMPS WITH LONGER OR SHORTER TO
MS21920-XX CLAMPS TO ACCOMMODATE VARYING DIAMETERS. ENSURE THERE IS A MINIMUM OF
1.5 THREADS IN SAFETY ON THE NUTS.
- 13) TORQUE CLAMPS 80 TO 100 IN-LB


SHOP COPY

UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE08-01-16
W37940

B	SUPPORT NOW MAGNOBONDED; REMOVE D2856-600-1009 ABRASION STRIP; UPDATED NOTES; ADDED D3595-063-530 CUSHION	MB	07.12.03
A	NEW ISSUE	DS	02.05.27
REV.	DESCRIPTION	BY	DATE
DESIGN		DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN			
CHECKED		DRAWING NO.	REV. B
MFG. APPR.		D205-596-103	SHEET 1 OF 2
APPROVED		TITLE	SCALE
DE APPR.		CROSSTUBE ASSEMBLY, HI-HI AFT	NTS
DATE	07.12.03	COPYRIGHT © 2002 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

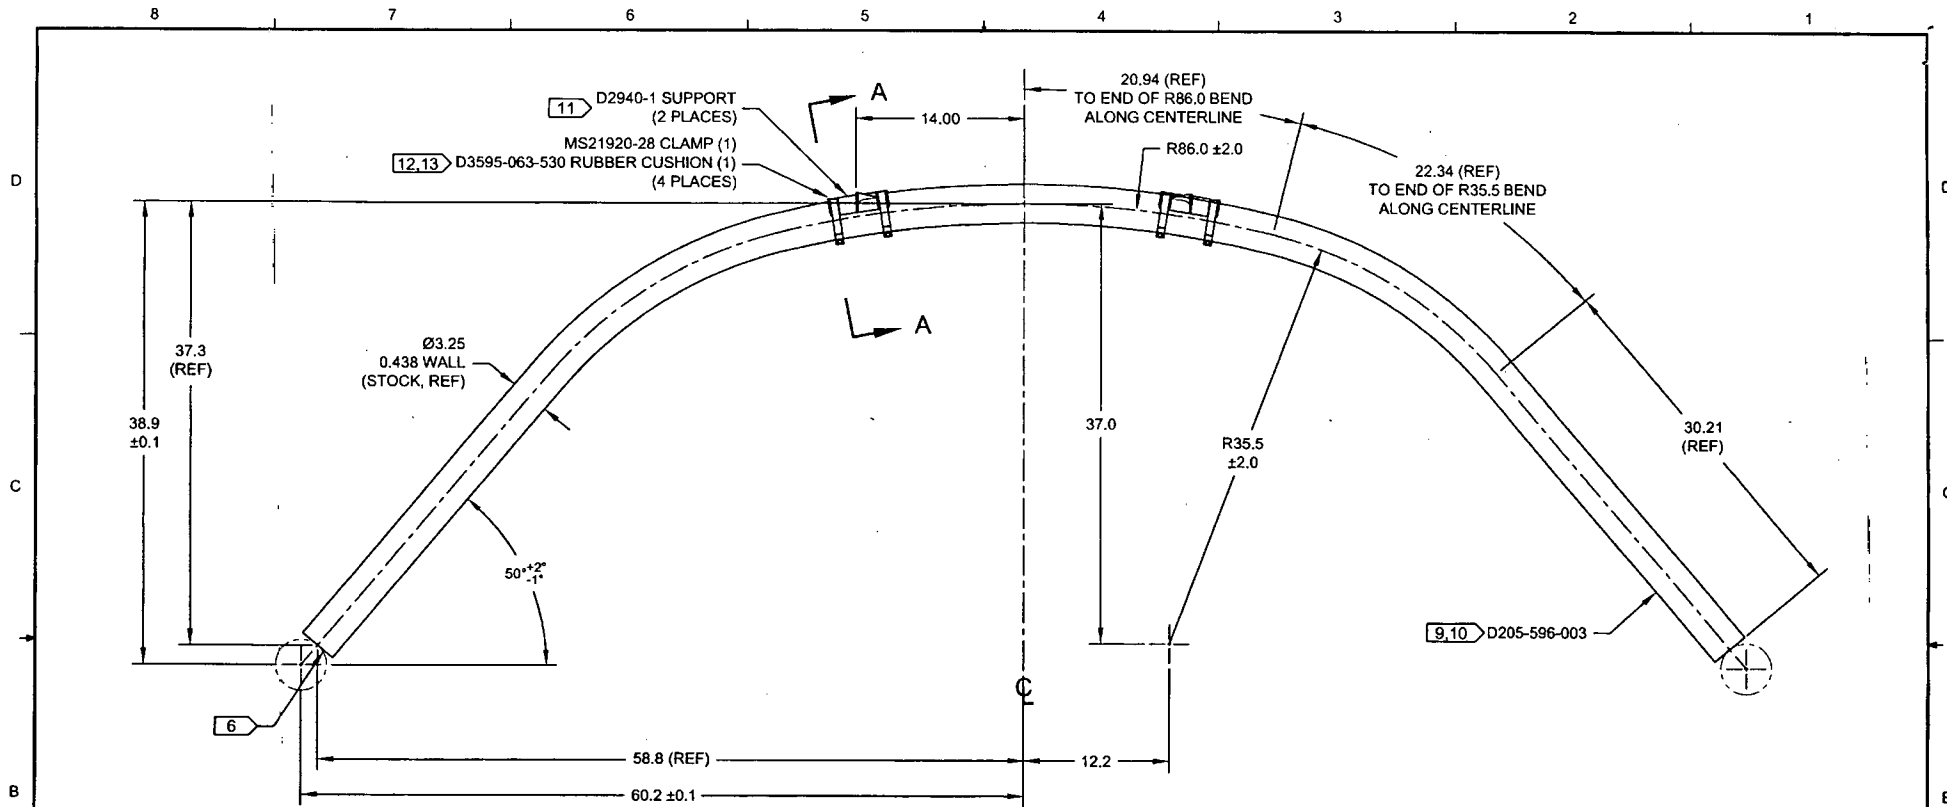

D205-596-103 CROSSTUBE ASSEMBLY, HI-HI AFT

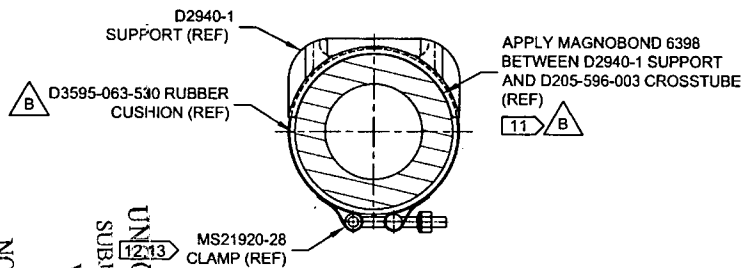

SECTION A-A
SCALE 2:5

RELEASED
108 of 167

DESIGN	4	DART AEROSPACE LTD	
DRAWN	4	HAWKESBURY, ONTARIO, CANADA	
CHECKED	PH	DRAWING NO.	REV. B
MFG. APPR.	PH	D205-596-103	SHEET 2 OF 2
APPROVED	PH	TITLE	SCALE
DE APPR.	PH	CROSSTUBE ASSEMBLY, HI-HI AFT	1:1
DATE	07.12.03	COPYRIGHT © 2002 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

NO. 379440
WORK ORDER
SUBJECT TO APPROVAL
WITHOUT PRICE
UNION ROTARY COPY
ENGINEER'S NO.
RETURN TO
SHOP COPY